


**C.I.P.****17 Libra**

Ursprungsland: CZ

TAB. I

Datum 01-01-22

Revision 02-05-15

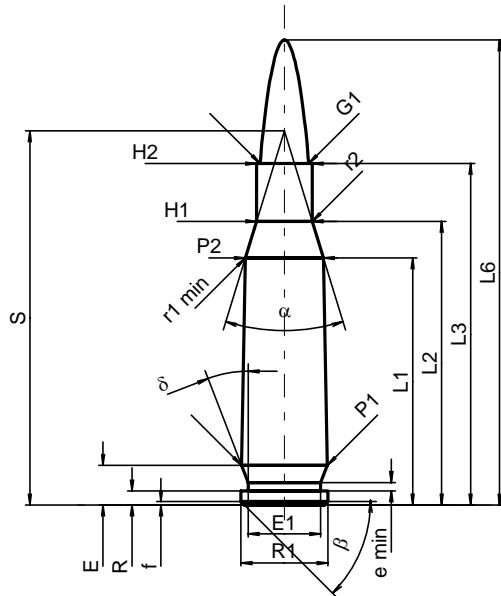**PATRONE MAXI****Längen**

L1 <sup>1)*</sup>	=	21.78	-0.20
L2 <sup>1)*</sup>	=	25.01	-0.20
L3 <sup>1)</sup>	=	30.10	
L4	=		
L5	=		
L6	=	41.00	

**Hülsenboden**

R	=	1.24	
R1	=	7.65	
R3	=		
E	=	3.50	
E1	=	6.40	
e min	=	0.75	
delta	=	20°	
f	=	0.30	
beta	=	45°	

**Pulverkammer**

P1	=	7.56	
P2 <sup>1)*</sup>	=	6.88	-0.20

**Schulterkonus**

alpha	=	34°04'51"	
S	=	33.00	
r1 min	=	0.64	
r2	=	2.54	

**Hülsenhals**

H1*	=	4.90	
H2 <sup>1)</sup>	=	4.90	

**Geschoss**

G1 <sup>1)</sup>	=	4.28	
G2	=		
F	=		
L3+G <sup>1)</sup>	=	32.87	

**Drücke (Energien)****Mech. elektr. Wandler**

Pmax	=	4300 bar	
PK	=	4945 bar	
PE	=	5375 bar	
M	=	17.50	
EE	=	1500 Joule	

**Verschiedene Daten**

Fe <sup>1)</sup>	=	0.10	
delta L	=	0.25	

**PATRONENLAGER MINI****Längen**

L1*	=	21.35	
L2*	=	24.63	
L3 <sup>1)</sup>	=	30.20	

**Stoßboden**

R	=		
R1	=	7.67	
R2	=		
R3	=		
r	=		

**Pulverkammer**

E	=	2.77	
P1 <sup>1)</sup>	=	7.62	
P2*	=	7.00	

**Schulterkonus**

alpha <sup>1)</sup>	=	34°13'48"	
S	=	32.72	
r1 max	=	0.64	
r2	=	3.18	

**Hülsenhals**

H1*	=	4.98	
H2 <sup>1)</sup>	=	4.90	

**Geschossübergang**


G1 <sup>1)*</sup>	=	4.40	
G <sup>1)*</sup>	=	2.77	
alpha1	=	90°	
h*	=	0.25	
s	=		
i <sup>1)</sup>	=	1°28'39"	
w	=		

**Lauf**

F <sup>1)*</sup>	=	4.27	
Z <sup>1)</sup>	=	4.40	

**Züge**

b	=	1.57	
N	=	6	
u	=	229.00	
Q	=	14.95	mm <sup>2</sup>

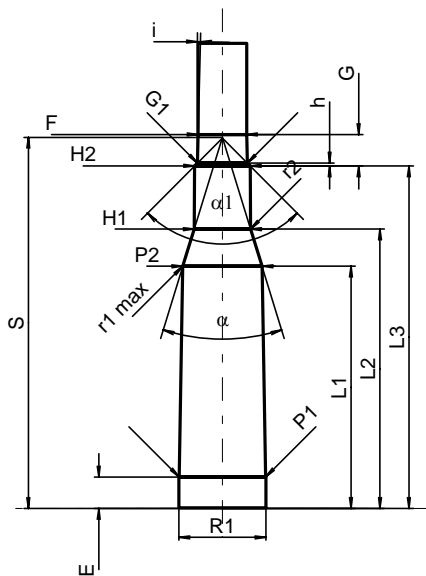

Maßstab 1.5:1

Maße in << mm >>  
Maße und Toleranzen für Messläufe  
siehe Anhang CR 1.

Bemerkungen: 1) Kontrolle aus Sicherheitsgründen  
\* Grundmaße